PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

TITLE D3000 OPERATOR CONTROL PANEL SWITCHES					рів NO. DK3031
ORODUCT TAPE II DISK IX LINE: FORMATTER II	EQUIPMENT CHANGED Switch 102357-XX		MODEL SERIES AFFECTED D3000		EFFECTIVE DATE 4/15/75
CLASS OF BULLETIN:		ORDER PART KIT NQ.		EFFECTIVITY	
■ IMPROVEMENT □ RETROFIT ON FAILURE □ RETROFIT RECOMMENDED IX SERVICE INFORMATION ONLY		N/A		All D3000 Disk Drives	
				_	

PURPOSE:

Current production D3000 operator control panel assemblies are being equipped with Licon brand switches instead of Compulites. Operationly these two switches are identical. There are however, some integral differences which are outlined below.

• Although the switch assemblies are interchangeable, the switch caps, between Licon and Compulite, are not. i.e., READY, SAFE, PROT/PROT and RUN/STOP. Should a cap replacement on a Compulite switch become necessary a complete Licon switch with cap should be ordered. Licon numbers are as follows:

Switch with cap	P/N
RUN/STOP	102357-27
SAFE	102357-28
READY	102357-29
PROT/PROT	102357-30

- When replacing a switch in the operator control panel, refer to appropriate figure for wiring. (Attached)
- Ensure that before installing the switch that the switch terminals are twisted 45°. If the 45° twist does not exist, the terminal could be pushed into the switch body causing damage inside the switch.

and Additional Information Be Required — Contact

PERTEC 20 K012C111

PERIPHERAL EQUIPMENT DIVISION 9600 Irondale Avenue, Chatsworth, California 91311 Phone (213) 882-0030 / TWX (910) 494-2093 ATTENTION: PRODUCT SUPPORT MANAGER Distribution Code - 6318



PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

