

PERIPHERAL EQUIPMENT DIVISION

TITLE EXTRA UPPER SECTOR PULSES				PIB NO. DK3064
PRODUCT LINE	TAPE DISK FORMATTER	EQUIPMENT CHANGED	MODEL SERIES AFFECTED D3000	EFFECTIVE DATE 7/21/76
CLASS OF BULLETIN:		ORDER PART KIT NO.	EFFECTIVITY	
<input type="checkbox"/> IMPROVEMENT <input checked="" type="checkbox"/> RETROFIT ON FAILURE <input type="checkbox"/> RETROFIT RECOMMENDED <input type="checkbox"/> SERVICE INFORMATION ONLY		N/A	Logic pcba 102831-XX 103705-XX  On units shipped prior to Sept. 1976	


**PURPOSE:** To eliminate extra upper-sector pulses due to limited slew rate of 741 op-Amp, U425

**SYMPTOMS:** Random extra upper-sector or index pulses

<u>PARTS REQUIRED:</u>	QTY	PERTEC P/N	DESCRIPTION	VENDOR P/N
	1	400-0318	op-Amp, single/ high speed/8 pin dip/	National LM318N

**PROCEDURE:** Remove existing U425 (400-2741) and replace with P/N 400-0318. After rework, reidentify as: 103705-XX + ECN 8794A  
102831-XX + ECN 8793A

**DOCUMENTATION:** Change the schematic to reflect new P/N

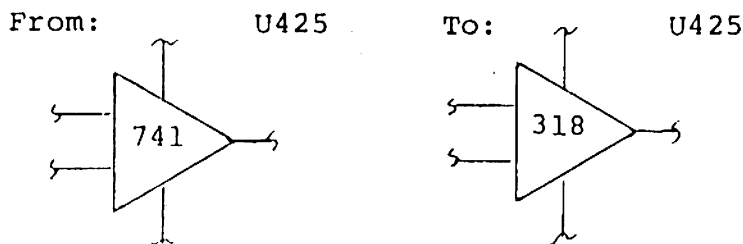

Should Additional Information Be Required — Contact

**PERTEC**

PERIPHERAL EQUIPMENT DIVISION  
 9600 Irondale Avenue, Chatsworth, California 91311  
 Phone (213) 882-0030 / TWX (910) 494-2093  
 ATTENTION: PRODUCT SUPPORT MANAGER

DISTRIBUTION CODE 6318