

PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

TITLE CARTRIDGE DOOR C	PIB NO. DK 3067				
RODUCT TAPE (DISK X FORMATTER	EQUIPMEN	A MODEL SERIES AFFECTED D3000 (Front loads)		EFFECTIVE DATE 2/15/77	
CLASS OF BULLETIN:		ORDER PAR KIT NO.	EFFE EFFE	EFFECTIVITY	
(_) IMPROVEMENT (X) RETROFIT ON FAILURE		N/A	Front load D3	000 prior to april	
[] RETROFIT RECOMMENDED [] SERVICE INFORMATION ONLY					

PURPOSE:

To inform customers of a dimension change to the Door Opener (P/N 102624-01) and Spring (P/N 102753-02) that would insure the return of the Cartridge Door Opener to its original position.

SYMPTOMS:

Excessive binding of the cartridge-Door-Opener, resulting in failure to open the Disk Cartridge upon insertion.

PARTS REQUIRED:

PTY.	NOMENCLATURE	PERTEC P/N	MANUFACTURERS P/N
1 1	Spring Door Opener	102753-02 102624-01	
3	Washers, flat #6, thin Ring retaining, .312 dia.,	606-0600	Putor Glin CHE 12
T	shaft, .025 thick	011-3203	Rutor Clip, SHF-12

SPECIAL TOOLS: None

Juld Additional Information Be Required — Contact

PERTEC

DISTRIBUTION CODE 6318



PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

TITLE CARTRIDGE DOOR OPENER BINDING ON FRONT LOADS

PIB NO. DK3067

INSTALLATION PROCEDURE:

- 1. Remove old Door-Opener and hardware.
- Install new Door-Opener, identifiable by dimension change; (See figure 1 below)
- 3. Install new Spring and hardward in accordance with Figure 2. NOTE: Extra washers and retaining clip.

