

PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

TITLE REDUCE POSITIONE	DK 30 69		
PRODUCT TAPE X LINE: FORMATTER	EQUIPMENT CHANGED Servo	MODEL SERIES AFFECTED D3000	EFFECTIVE DATE 3/30/77
CLASS OF BULLETIN. [X IMPROVEMENT [] HETROFIT ON FAILURE [] RETROFIT RECOMMENDED [] SERVICE INFORMATION ONLY	ORDER PA KIT NO N/A	1 5 /27 10 20 12 7	

PURPOSE:

Reduce the velocity of the positioner during an unload condition.

SYMPTOMS:

Previous velocity was in excess of what was actually necessary to unload the heads.

PARTS REQUIRED:	Qty.	Pertec P/N	Nomenclature
	1	330-0565	Diode, Zener, 5.6V ± 5% lw
	1	691-9022	Wire, insulated, solid 22 AWG, white

SPECIAL TOOLS REQUIRED: NONE

INSTALLATION PROCEDURE:

Refer to PCBA drawing 102811 for component locations.

DELETE:	Ref.	Nomenclature	Pertec P/N
	R129	Resistor	Option
	R130	Resistor	115-0002
	CR31	Diode	300-4002

ADD:

Wire (W13) in location of R129

Diode, Zener (VR20) in location of CR31

ADJUSTMENTS: NONE

TEST PROCEDURES:

Insert cartridge.

2) Activate RUN and bring unit to Ready condition.

While monitoring the heads, unplug the power and ensure that the unit's Emergency Unload Circuit will retract the heads of the disk.

NOTE: In case the heads fail to retract, manually retract them and

verify the rework instructions.

Should Additional Information Be Required — Contact

PERIPHERAL EQUIPMENT DIVISION 9600 Irondale Avenue, Chatsworth, California 91311 Phone (213) 882-0030 / TWX (910) 494-2093 ATTENTION PRODUCT SUPPORT MANAGER DISTRIBUTION CODE 6318

 $g_{\rm Math} = -1$

PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

FITLE REDUCE POSITIONER EMERGENCY UNLOAD VELOCITY

PIB NO. DK3069

BOARD/DRAWING/MANUAL CHANGES: DWG. 102810, Servo Schematic

Sheet 1 Table III

In Delete Column

ADD:

CR31, R129 & R130


In Last Used Column

FROM: VR19 to V R20


FROM: W12 to W13

Sheet 1 Zone 10-B

FROM:

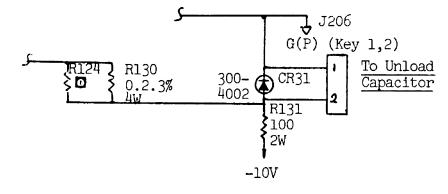

TO:

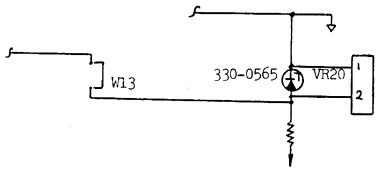

Sheet 3 Table I

Delete: R130 at 115-0002 Delete:

CR31 at 300-4002

Add: 691-9022 W13


330-0565 VR20

Sheet 3 Table II R124 - Delete omi t <u>-01</u> _-02 <u>-31</u> omit -32 omit <u>04-</u>2 omit <u>34</u>



PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

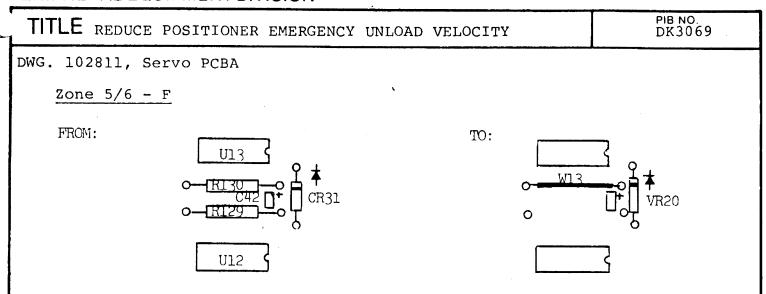

Stamp + PIB 3069

TIME REQUIRED: 1 hour

- D