

PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION

TITLE HI-POT TESTING				РІВ NO. DK3071	
PRODUCT TAPE DISK X LINE: FORMATTER	EQUIPMENT CHANGED Power Supply		MODEL SERIES AFFECTED	EFFECTIVE DATE	
			D3000	7/25/77	
CLASS OF BULLETIN:		ORDER PAR KIT NO.	103581-01 Rev. D 103581-02 Rev. D	EFFECTIVITY 103581-01 Rev. D or E 103581-02 Rev. D or E	
RETROFIT ON FAILURE XX RETROFIT RECOMMENDED SERVICE INFORMATION ONLY		N/A	103581-05/-06/-07/-08 Rev. A Units having Motor Control PCBA 103571-XX mounted with 3/16 inch spacers (previously 3/8 inch).		

PURPOSE:

To inform customers that certain Disks (see effectivity) may not pass the alternate method of the C.S.A. Hi-Pot Test.

SYMPTOMS:

All C.S.A. approved units will pass @ 1000 VAC for 60 seconds, but may not pass @ 1700 VDC for 15 seconds.

PARTS REQUIRED:

QTY.

NONENCLATURE

PERTEC P/N

1

Screw, nylon 10-33 X3/8

615-0091

SPECIAL TOOLS: NONE

INSTALLATION PROCEDURE:

- 1. Remove power from unit.
- 2. Raise Logic PCRA.
- 3. Remove Motor Control Protective Cover (marked Danger High-Voltage).
- 4. Remove the Motor Control PCBA P/N 103571-0X.
- 5. Remove the screw, Phillips pan head 10-32 X3/8 closest to the heads (see figure 1).
- 6. Install Mylon Screw, P/M 615-0091 (see figure 1).
- 7. Return to original configuration.

ADJUSTMENTS: NONE

TEST PROCEDURES: NONE

BOARD/DRAWING/MANUAL CHANGES: Reidentify Power Supply:

103581-01/-02 Rev. D to +3071 103581-01/-02 Rev. E to Rev. F

103581-05,06,07,08 Rev. A to Rev. B

TIME REQUIRED: .25 Hrs.

Should Additional Information Be Required - Contact

PERTEC

PERIPHERAL EQUIPMENT DIVISION
9600 Irondale Avenue, Chatsworth, California 91311
Phone (213) 882-0030 / TWX (910) 494-2093
ATTENTION: PRODUCT SUPPORT MANAGER
PERIFC 20 FOLCO (1)

DISTRIBUTION CODE 6318



PRODUCT IMPROVEMENT BULLETIN

PERIPHERAL EQUIPMENT DIVISION TITLE HI-POT TESTING PIB NO. DK3071 POSITIONER MAGNET REMOVE & REPLACE THIS SCREW WITH NYLON SCREW P/N 615-0091 Figure 1.