

### PERIPHERAL EQUIPMENT DIVISION

<b>TITLE</b> EXTRA INDEX PULSES (32 SECTOR, 2400 RPM CHLY)			PIB NO. DK3072		
<b>PRODUCT LINE:</b>	<b>TAPE DISK FORMATTER</b>	<b>EQUIPMENT CHANGED</b> Logic PCBA	<b>MODEL SERIES AFFECTED</b> D3XX2-M032	<b>EFFECTIVE DATE</b> 9/1/77	
<b>CLASS OF BULLETIN:</b> <input checked="" type="checkbox"/> IMPROVEMENT <input checked="" type="checkbox"/> RETROFIT ON FAILURE <input type="checkbox"/> RETROFIT RECOMMENDED <input type="checkbox"/> SERVICE INFORMATION ONLY		<b>ORDER PART KIT NO.</b>  N/A	<b>EFFECTIVITY</b>  32 Sector, 2400 RPM Disks		
<b>PURPOSE:</b> To inform you of Programming Array modification in location J121 of Logic PCBA.					
<b>SYMPTOMS:</b> Erroneous sector demultiplexing on 32 sector, 2400 RPM Disks, resulting in extra Index Pulses.					
<b>PARTS REQUIRED:</b>					
Qty.	Nomenclature		Pertec P/N		
1	Programming Array PC121		103611-05 Rev. B		
<b>SPECIAL TOOLS:</b> NONE					
<b>INSTALLATION PROCEDURE:</b>					
1. Remove Disk Cover. 2. Swing Logic PCBA up. 3. Swing out the Servo PCBA. 4. Locate Platform J121, P/N 103611-05A and remove. 5. Install new Platform, P/N 103611-05 Rev. B. A. Beware of polarity. 6. Return to original configuration.					
<b>ADJUSTMENTS:</b> NONE					
<b>TEST PROCEDURES:</b>					
1. Run Disk Diagnostic Test if available. 2. Attempt to Read or verify previously written Disk Cartridges.					
<b>BOARD/DRAWING/MANUAL CHANGES:</b> NONE					
<b>TIME REQUIRED:</b> 15 minutes					

Should Additional Information Be Required — Contact

**PERTEC**

PERIPHERAL EQUIPMENT DIVISION  
 9600 Irondale Avenue, Chatsworth, California 91311  
 Phone (213) 882-0030 / TWX (910) 494-2093  
 ATTENTION: PRODUCT SUPPORT MANAGER

PERTEC 20-K012C(1)

DISTRIBUTION CODE 6318