

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

|              |                     |
|--------------|---------------------|
| Bulletin No. | 0312-11             |
| Description  | TRSDOS              |
| Model        | Model III           |
| Stock No.    | 26-0312 Version 1.3 |
| Date         | November 9, 1982    |
| Page 1 of    | 1                   |

### Problem

In the Basic Language Reference Manual (26-2112, Model III), in the section entitled "Using the RS-232 C Interface", the word bit codes are incorrect. The bit pattern of WORD=6 and WORD=7 is inverted.

\* \* THE FOLLOWING PATCHES ARE REQUIRED! \* \*

### Solution

At TRSDOS Ready, apply the following patches.

PATCH \*9 (ADD=5DCE,FIND=40,CHG=20)

PATCH \*9 (ADD=5DD5,FIND=20,CHG=40)