

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	1590-09
Description	SuperSCRIPSIT
Model	Model III
Stock No.	26-1590 Version 01.02.05
Date	March 23, 1984
Page 1 of	1

Problem

When typing form letters, when the next to the last line of the document is indented, the last line is also indented when the merge letter is printed.

* * THE FOLLOWING PATCH IS REQUIRED! * *

Solution

At TRSDOS READY, type:

```
PATCH SCR18CTL (ADD=9665,FIND=03,CHG=01)
PATCH SCRIPSIT/CMD (ADD=642F,FIND=23FEEF,CHG=CD007D)
PATCH SCRIPSIT/CMD (ADD=7D00,FIND=00000000,CHG=23FEEFC8)
PATCH SCRIPSIT/CMD (ADD=7D04,FIND=000000,CHG=FEEDC9)
PATCH SCR17/CTL (ADD=8EC7,FIND=35,CHG=36)
```

After the PATCHES from this bulletin have been applied the Version number will be 01.02.06. Please make the necessary entry in your Version Log.