

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	2203-01 (Correction 2)
Description	COBOL COMPILER
Model	Model I/III
Stock No.	26-2203 Version 01.3b.06
Date	October 11, 1982
Page 1 of	1

Problem

It's been reported that line feeds generated during run time cause an I/O ERROR CODE 30 when, in fact nothing is really wrong.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

The problem may be corrected by applying the following patches on your Model I and Model III COBOL.

At TRSDOS READY key the following:

```
PATCH RUNCOBOL/CMD (ADD=A5F4,FIND=28,CHG=18)
PATCH RUNCOBOL/CMD (ADD=A602,FIND=28,CHG=18)
PATCH RUNCOBOL/CMD (ADD=A612,FIND=C2CEA6,CHG=000000)
PATCH RUNCOBOL/CMD (ADD=A642,FIND=CA,CHG=C3)
PATCH RUNCOBOL/CMD (ADD=A653,FIND=C2CEA6,CHG=000000)
PATCH RUNCOBOL/CMD (ADD=A665,FIND=CA,CHG=C3)
```

After applying these patches, line feeds to the printer will not cause I/O ERROR 30 to appear without a valid reason.