

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	415 <del>0</del> - <del>0</del> 2
Description	TRSDOS-HD
Model	Model II
Stock No.	26-415 <del>0</del> Version 4. <del>0</del>
Date	March 2, 1982
Page 1 of	1

### Problem

When 48~~00~~ BAUD operation was specified using either the SETCOM command or the RS232 Initialization Supervisor Call (55), the actual BAUD rate was being set to 96~~00~~ BAUD.

### Solution

The following patch is for the TRSDOS-HD 4.~~0~~ only and will correct the problem described above.

PATCH SYSTEM/SYS R=68 B=139 F=~~0~~D C=1A