

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

<b>Bulletin No.</b>	4150-06 (Correction 1)
<b>Description</b>	TRSDOS-II
<b>Model</b>	Model II
<b>Stock No.</b>	26-4150 Version 4.1
<b>Date</b>	Sept. 9, 1982
<b>Page 1 of</b>	1

### Problem

The "I" command does not work correctly. This problem occurs when swapping diskettes.

\* \* \* THESE PATCHES ARE REQUIRED. \* \* \*

### Solution

The following "PATCH" sequence will remedy this situation.

```
PATCH SYSRES/SYS R=15 B=88 F=203BC5 C=C52039
PATCH SYSRES/SYS R=15 B=99 F=29 C=2A
PATCH SYSRES/SYS R=15 B=108 F=0911980E C=03C3981D
PATCH SYSRES/SYS R=30 B=37 F=0000000000000000 C=D511980EEDA0EDA8
PATCH SYSRES/SYS R=30 B=45 F=0000000000000000 C=4E23462BC37A0E
PATCH SYSRES/SYS R=15 B=116 F=1814EDA0EDA8 C=4E23462BD500
PATCH SYSRES/SYS R=15 B=141 F=E5 C=D1
PATCH SYSRES/SYS R=15 B=145 F=36FF61 C=C3A71D
PATCH SYSRES/SYS R=30 B=52 F=0000000000000000 C=36FF6069C38A0E
PATCH SYSRES/SYS R=15 B=148 F=C1545D7E23666F C=545D7E23666FC1
```