

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	415Ø-12
Description	TRSDOS Hard Disk
Model	Model II
Stock No.	26-415Ø Version 4.1
Date	November 1, 1982
Page 1 of	1

Problem

It is not possible to change the number of read/write retries made when accessing the hard disk.

* * THE FOLLOWING PATCH IS REQUIRED! * *

Solution

The following patch will allow the user to change the number of read/write retries made when accessing the hard disk. The controller will make a number of accesses equal to 16 times the digit in the first byte of the patch before rendering a sector unaccessible. The second byte of the patch relates to the number of attempts the controller will make to verify read after write.

At TRSDOS Ready, apply the following patch.

PATCH SYSRES/SYS R=2Ø B=16 F=Ø1Ø1 C=Ø3Ø3

NOTE: The system must be rebooted to effect the change.