

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4507-01
Description	Mailing List II
Model	Model II
Stock No.	26-4507 Version 2.0
Date	Feb. 24, 1982
Page 1 of	1

### Problem

MLS II system will not expand when given capacity is reached. Error message appears.

### Solution

The problem is corrected by following the steps listed below.

1. Backup the diskette(s) and make the changes on the Backup copy of the program.
2. In BASIC load the program by typing LOAD"SETUP/BAS".
3. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 1270 IFRV<=0ORRV>CPTHEN1250ELSECP=RV

New Line: 1270 IFRV<=0ORRV>CPTHEN1250

ADD THIS NEW LINE:

985 IFM=85THENC=3000ELSECP=2000

4. Type SAVE"SETUP/BAS" to save the changes in the program.
5. At TRSDOS READY, make a backup copy of the corrected diskette.