

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4507-02
Description	MLS II
Model	Model II
Stock No.	26-4507 Version 2.0
Date	Sept. 16, 1982
Page 1 of	1

### Problem

The program produces a phantom linefeed on the third set of two-up labels if you are using a LPII or LPIV and the address printed is only 3 lines.

\* \* THE FOLLOWING LINE CHANGE IS OPTIONAL! \* \*

### Solution

The problem is corrected by following the steps listed below.

1. Backup the diskette(s) and make the changes on the Backup copy of the program.
2. In BASIC load the program by typing LOAD"MLS/BAS".
3. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 3010 IFH=0 THEN L\$(IZ,1)=H2\$ ELSE L\$(IZ,0)=SPACE\$(IH-3)

New Line: 3010 IFH=0 THEN L\$(IZ,1)=H2\$ ELSE L\$(IZ,0)=" "

4. Type SAVE"MLS/BAS" to save the changes in the program.
5. At TRSDOS READY, make a backup copy of the corrected diskette.