

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4531-01
Description	SCRIPSIT
Model	MODEL II
Stock No.	26-4531 VERSION 2.0
Date	Nov. 16, 1981
Page 1 of	1

Problem

Corrections for known bugs in the initial release of SCRIPSIT 2.0

Solution

The initial release of 2.0 SCRIPSIT has the following known bugs:

1. Sheet feeder error never gets reset.
2. Cosmetic problem in user key execution of define text block.
3. Intermittent problem in D option in save/recall format line.
4. Exiting from an printer error in Merge hangs system.
5. The following patches will correct these errors.

```
PATCH SCRIPSIT A=D6F0 F=0000000000000000 C=AF3203DB3AFDDAC9
PATCH SCRIPSIT/SYS R=155 B=223 F=3AFDDA C=CDF0D6
PATCH SCRIPSIT A=BA84 F=C50600 C=C3E0D6
PATCH SCRIPSIT A=D6E0 F=0000000000000000 C=D516003E0ACF
PATCH SCRIPSIT A=D6E6 F=0000000000000000 C=D1C50600C387BA
PATCH STARTUP A=E0B3 F=10 C=C0
PATCH SCRIPSIT A=D6F8 F=0000000000000000 C=ED73FBDACD15D9C9
PATCH SCRIPSIT/SYS R=139 B=225 F=15D9 C=F8D6
PATCH SCRIPSIT/SYS R=154 B=124 F=300332D4DA C=F50000000000
PATCH SCRIPSIT/SYS R=154 B=132 F=3AD4DAB7 C=F10000000000
PATCH SCRIPSIT/SYS R=158 B=45 F=AF C=00
PATCH SCRIPSIT/SYS A=E40E F=AAAAAAAAAAAAAAAAAAAA C=B1B0AFB1B6AFB1B9B8B1
```

When these patches have been made, the Scripsit initialization screen will show the date 10/16/1981 at the bottom. After the first 1000 or so, the disks had these patches made at the factory. So, if the date is visible, no patches need to be made.