

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4531-03
Description	SCRIPSIT
Model	Model II
Stock No.	26-4531 Version 2.0
Date	Dec. 10, 1981
Page 1 of	1

Problem

It has been discovered that SCRIPSIT will (at times) increment a character (if it follows a tab that is followed by a space) during print.

Solution

The following patches will correct this error;

1) At TRSDOS READY apply these patches on a backup copy of SCRIPSIT 2.0.

```
PATCH SCRIPSIT {A=D6C0 F=0000000000000000 C=7EFE20CA51F8FE09}
```

```
PATCH SCRIPSIT {A=D6C8 F=0000000000000000 C=CA51F8C33FF8}
```

```
PATCH SCRIPSIT/SYS {R=158 B=81 F=BE2812 C=C3C0D6}
```

```
PATCH STARTUP {A=E40E F=B1B1AFB1B1AFB1B9B8B1 C=B1B1AFB2B4AFB1B9B8B1}
```

2) When these patches have been made, the SCRIPSIT initialization screen will show the date 11/24/1981 at the bottom. The 10/16/1981 patches must be made before these patches are made.

3) You are now ready to resume use of SCRIPSIT 2.0.