

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	491Ø-28
Description	TRSDOS
Model	Model II
Stock No.	26-491Ø Version 2.Øb
Date	October 5, 1982
Page 1 of	1

Problem

When Bulletin 491Ø-27 is applied and an attempt is made to invoke "UNTHIN", the error message "STRING NOT FOUND" is generated. The following patches resolve this problem.

* * THE FOLLOWING PATCH IS REQUIRED! * *

Solution

* * NOTE * *

These patches are to be made only after the "THINLINE" DO file has been run and patches issued on bulletin #491Ø-27 have been applied.

At TRSDOS Ready, apply the following patches.

```
PATCH THINLINE R=379 B=1 F='1' C='2'  
PATCH THINLINE R=38Ø B=1 F='9' C='5'  
PATCH UNTHIN R=379 B=1 F='1' C='2'  
PATCH UNTHIN R=38Ø B=1 F='9' C='5'
```