

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	6105-04
Description	TRSDOS 16
Model	Model II/16
Stock No.	26-6105 Version 4.0
Date	March 2, 1982
Page 1 of	1

Problem

When 4800 BAUD operation was specified using either the SETCOM command or the RS232 Initialization Supervisor Call (55), the actual BAUD rate was being set to 9600 BAUD.

* * THE FOLLOWING PATCH IS REQUIRED! * *

Solution

The following patch is for the TRSDOS-HD 4.0 only and will correct the problem described above.

PATCH SYSTEM/SYS R=68 B=139 F=0D C=1A