

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	6105-08
Description	TRSDOS 16
Model	Model II/16
Stock No.	26-6105 Version 4.1
Date	Sept. 9, 1982
Page 1 of	1

Problem

The "I" command does not work correctly. This problem occurs when swapping diskettes.

* * * THESE PATCHES ARE REQUIRED. * * *

Solution

The following "PATCH" sequence will remedy this situation.

```
PATCH SYSRES/SYS R=15 B=88 F=203BC5 C=C52039
PATCH SYSRES/SYS R=15 B=99 F=29 C=2A
PATCH SYSRES/SYS R=15 B=108 F=0911980E C=03C3981D
PATCH SYSRES/SYS R=30 B=37 F=0000000000000000 C=D511980EEDA0EDA8
PATCH SYSRES/SYS R=30 B=45 F=0000000000000000 C=4E23462BC37A0E
PATCH SYSRES/SYS R=15 B=116 F=1814EDA0EDA8 C=4E23462BD500
PATCH SYSRES/SYS R=15 B=141 F=E5 C=D1
PATCH SYSRES/SYS R=15 B=145 F=36FFE1 C=C3A71D
PATCH SYSRES/SYS R=30 B=52 F=0000000000000000 C=36FF6069C38A0E
PATCH SYSRES/SYS R=15 B=148 F=C1545D7E23666F C=545D7E23666FC1
```