

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	6105-23
Description	TRSDOS-II/16
Model	Model II/12 16
Stock No.	26-6105 Ver. 04.01.00
Date	May 18, 1983
Page 1 of	1

Problem

Errors are occurring after SPOOL followed by a DO filename command. If SPOOL is on, the error 'OPEN ATTEMPT FOR FILE ALREADY OPEN' is returned. If SPOOL is off, the error 'PARAMETER FOR OPEN IS INCORRECT' is returned.

* * THE FOLLOWING PATCHES ARE REQUIRED FOR USE WITH ENHANCED MODEL II/12 AND MODEL 16 WHEN RUNNING TRSDOS-16! * *

Solution

PATCH IFC R=6 B=230 F=214300 C=C3913C
PATCH IFC R=11 B=178 F=000000000000 C=21C8FC2281FC
PATCH IFC R=11 B=184 F=000000000000 C=21C8FE2283FC
PATCH IFC R=11 B=190 F=000000000000 C=214300C3DC37