LINE PRINTER CONTROLLER

88-LPC BOARD Documentation

-contents-

THEORY OF OPERATION
SCHEMATIC DIAGRAM
ASSEMBLY PROCEDURE
ADDRESS SELECTION CHART

Theory of Operation

The 88-LPC provides communication between the Altair and the 88-LP line printer. The board can be jumpered for any one of 128 addresses and has full hardware interrupt capability. Address 2 should be selected if MITS software compatibility is required.

I. <u>Device Select Logic</u>

When the CPU executes an I/O instruction (IN or OUT) it places the device address (byte 2 of the instruction) on the 8 lower address bus lines.

The 8 lower address bus lines are fed to IC's P and R. If byte 2 of the I/O instruction is equal to the address selected for the controller board, N-8 goes low, partially enabling M-1 and M-13. N-8 is the board select signal.

The remaining address bit, AØ, selects either the control channel (M-13) or the data channel (M-1) depending on its state (high or low). If the address selected on the board is 2, 2 will select the control channel (AØ = low) and 3 will select the data channel (AØ = high).

II. Control Channel

An output instruction to the control channel causes the following sequence:

M-13 goes high; SOUT (a CPU status signal indicating an output instruction) pulls D-9 high, D-8 and F-5 go low; soon after the SOUT status goes active, the CPU pulls PWR low, indicating the data on lines DOØ-DO7 is valid; PWR pulls F-9 low and F-8 is low if the print head is at the HOME position (not printing); F-4 forces A-2 and A-13 high and G-1 low. (see timing diagrams)

The effect of the data from the accumulator follows (data lines DOØ-DO5):

Data Bit	Low	<u>High</u>	<u>Function</u>
0		Х	PRINT command
1		Х	LINE FEED
2		Х	CLEAR character buffer
3	Х	X	Disable Interrupt Enable Interrupt
4			Not used
5			Not used

An input instruction from the control channel disables D-8 and enables D-6 with the SINP status signal and thus enables Tl. (see timing diagrams) The status information that will be entered into the CPU accumulator follows:

Data Bit	Low	<u>High</u>	<u>Function</u>	
Ø		X	Printer buffer is empty. (Note that this signal goes active after the first character has been output to the printer and inactive after the 80th characte has been sent.)	
	Х		Buffer full	
1		Х	Not printing	
	Х		Print head in motion	
2		Х	Paper feeding normally	
	Х		Paper has jammed	
3		Х	Line Feed will be accepted if print head not in motion	
	Х		Line Feed is taking place	

A. Interrupt

If DO3 is low during an output to the control channel, A-l goes high and A-3 low, flipping A-6 high and A-8 low (gates A-6 and A-8 are an RS flip-flop), which pulls the data input of D-type flip flop Bb low. After a line has been printed, HOME goes low triggering Cb and clearing Ba.

Ba-5 goes low to clock Bb. The data at Bb-12 will transfer to Ba-9 and invert at K-13 (the interrupt output). Thus if DO3 is low, Bb-12 will go low, disabling the interrupt capability. When DO3 is high, an interrupt occurs after each line is printed, and reset each time a print command is sent.

B. Print Command

A PRINT is issued either via the control channel or automatically when the printer buffer is full (80 characters). When the EMPTY signal returns inactive (the buffer is full), Ba-6 flips low, causing RUN to go low and printing begins.

To print a line of less than 80 characters, DOØ of the control channel causes Ba-6 to go low. Ba is cleared as described above in A.

III. Data Channel

When a character consisting of a 6-bit ASCII word is output to the data channel, it is transmitted to the printer as follows:

With N-8 low (board select) and AØ high (data channel select), M-1 and D-1 go high. DOØ-DO5 are fed through the board via S and J. D-2 goes high with the output status (SOUT) and when data is valid, D-13 goes high (since PWR goes low) causing D-12 and H-5 to go low. This signal, STB, strobes the data on DOØ-DO5 into the 80 character buffer in the printer. The line printer manual contains a chart showing the bit pattern for each character.

IV. Manual Control

There are two switches on the top, front of the printer labeled LINE and FEED.

LINE: This switch causes the 88-LPC to be active or inactive. When the lamp within the push switch is lit, the 88-LPC is ON LINE, i.e. the computer has control of the printer.

FEED: This switch is used for manually advancing the paper. Each time it is pressed, the paper will feed one line. If the switch is held down, a line feed will occur approximately once every 100 milliseconds. Note that this switch works only when the printer is OFF line.

V. Operating Procedure

- 1) Insert 88-LPC in Altair and connect to the line printer.
- 2) Turn Altair on.
- 3) Turn Line Printer on (on-off switch is on the left, back panel).
- 4) Depress FEED paper should advance freely.
- 5) Depress LINE light should come on.

On the next page is a test program that should print one complete line of each of the 64 characters. Note that one line will be blank (space = 100000). Note also that this test uses addresses 2 & 3 (as noted by *).

6) PAPER: We recommend using 20 lb., 4-part paper with 9-inch spacing between holes.

LINE PRINTER TEST PROGRAM


(Prints 64 lines - one of each character)

LOCATION	INSTRUCTION	REMARKS
0000000	006	
1	000	
2	170	
3	000	fill buffer with 80 identical characters (B register)
4	323	
5 6	003*	
6	333	
7	002*	
10	346	
11 12	001	
	302	
13 14	002 000	
14	000	← buffer full, printing starts
15	333	+ butter tuit, princing starts
16	002*	
17	346	loop until printing stops
20	002	toop until printing stops
21	312	· ·
22	015	
23	000	•
24	170	•
25	376	if all 64 characters have been printed, then stop
26	077	·
27	312	•
→ 3 0	036	
31	00 0	
	201	
32	004	increment B register for next character - go back
33	303	and fill buffer
34 35	002	
აე	000	
36	303	end of program
30 37	036	the or program
40	000	
70	1 000	


TIMING DIAGRAMS

88-LPC Board


OUTPUT INSTRUCTION

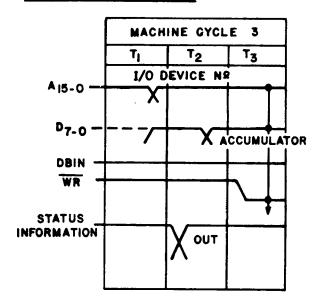

INPUT INSTRUCTION

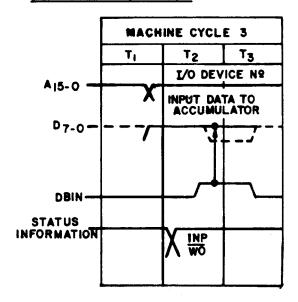

;

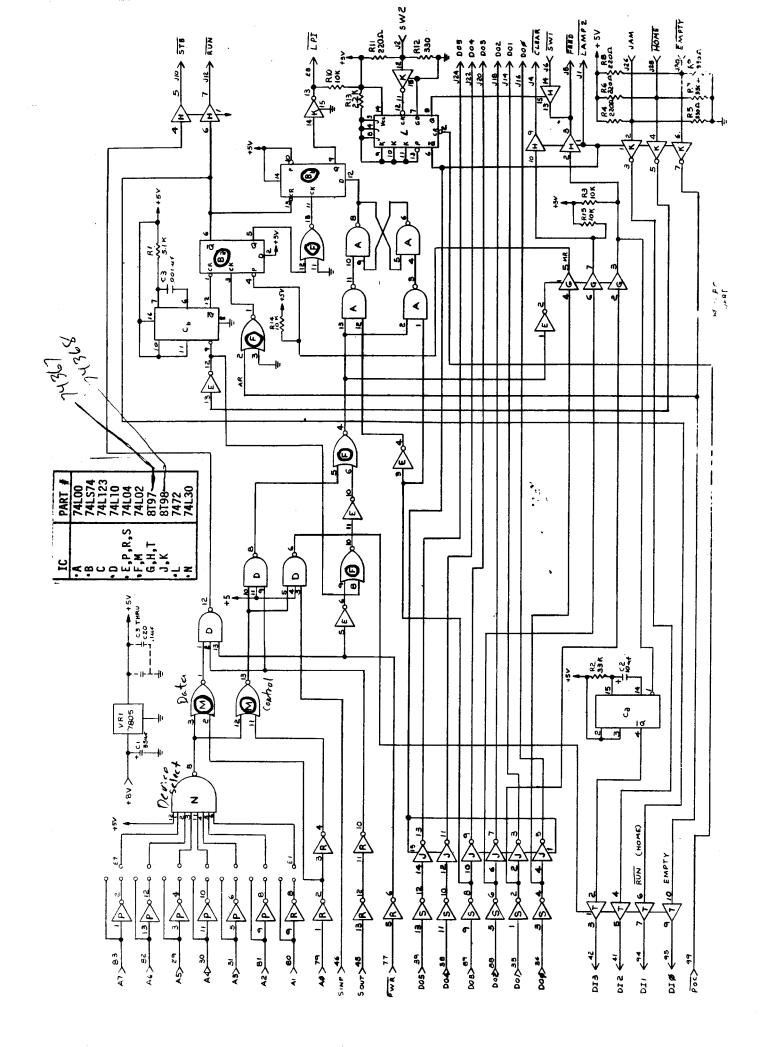

<u>.</u>.

88-LPC Board Assembly Manual

Assembly Procedure

Integrated Circuit Installation

There are 17 integrated circuits (IC's) to be installed on the 88-Line Printer Controller Board. Be certain that you choose the IC with the correct part number as you install each one.

- () Beginning with IC A -- part number 74L00 -- remove the IC from its holder. If there are any bent pins, straighten these using needle-nose pliers.
- () Orient the IC so that the notched end is toward the end with the arrowhead printed on the PC board. Pin 1 of the IC should correspond with the pad marked with the arrowhead.

 $\frac{\text{NOTE}}{\text{on one end}}$. If the IC does not have a notch on one end, refer to the IC Orientation Chart included with your manual for the identification of pin 1.


() When you have the correct orientation, start the pins on one side of the IC into their respective holes on the silk-screened side of the PC board. DO NOT PUSH THE PINS IN ALL THE WAY. If you have difficulty getting the pins into the holes, use the tip of a small screwdriver to guide them.

- () Start the pins on the other side of the IC into their holes in the same manner. When all of the pins have been started, set the IC in place by gently rocking it back and forth until it rests as close as possible to the board. Make sure that the IC is perfectly straight and as close as possible to the board; then tape it in place with a piece of masking tape.
- () Turn the board over and solder each pin to the foil pattern on the back side of the board. Be sure to solder each pin and be careful not to leave any solder bridges.
- () Turn the board over again and remove the piece of masking tape.

Referring to the component layout, use the same procedure to install each of the IC's. Be sure that you have the correct part number and the correct orientation as you install each one.

(7 IC N is a 74L30 74367 or 8097 Substitle for 87797 (-) IC L is a 7472 (/ IC's E, P, R'& S'are 74L04's (✓) IC's F & M are 74L02's
(✓) IC's Ğ, H & T are 8T97's (√) IC's J & K are 8T98's (J) IC C is a 74L123 (V IC B is a 74LS74 (// IC D is a 74L10 (Y) IC A is a 74L00

ффффф

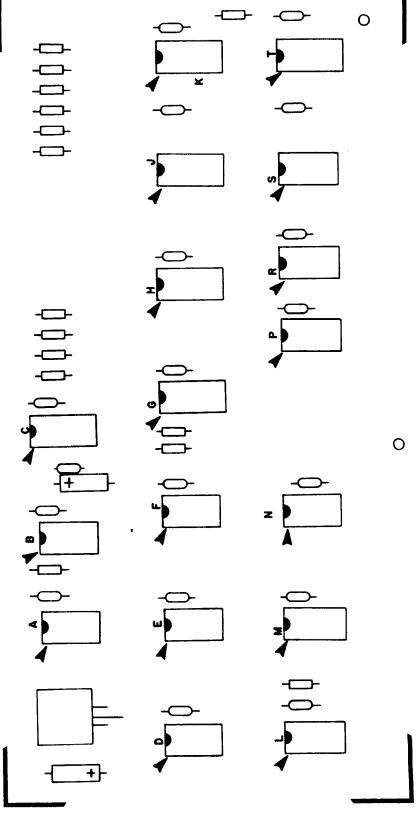

Resistor Installation

There are 15 resistors to be installed on the 88-LPC board.

NOTE: Resistors are color coded according to their value. The resistors in your kit will have four or possibly five bands of color. The fourth band in both cases will be gold or silver, indicating the tolerance. In the following instructions we will be concerned only with the three bands of color to one side of the gold or silver band. Be sure to match these three bands of color with those called for in the instructions as you install each resistor.

As each resistor is installed, use needle-nose pliers to bend the leads at right angles to match their respective holes on the PC board. (see component layout)

NOTE: All of the resistors on the board will be 1/2W or 1/4W.

- () Install resistor R1 (5.1K ohm, green-brown-gold) into the correct holes on the silk-screened side of the PC board.
- () Holding the resistor in place with one hand, turn the board over and bend the two leads slightly outward.
- () Solder the leads to the foil pattern on the back side of the board; then clip off any excess lead lengths.

Referring to the component layout, install the remaining resistors in the same manner. Be sure you have the correct color coding for each one as you install them.

(of R1 is a 5.1K ohm, green-brown-red.


(V/R2 is a 30K ohm, orange-black-orange

(L) R3, R10, R14 and R15 are 10K ohm, brown-black-orange

(4 R4, R6, R8 and R11 are 220 ohm, red-red-brown

(4785, R7, R9 and R12 are 330 ohm, orange-orange-brown

() Rl3 is 2.2K ohm, red-red

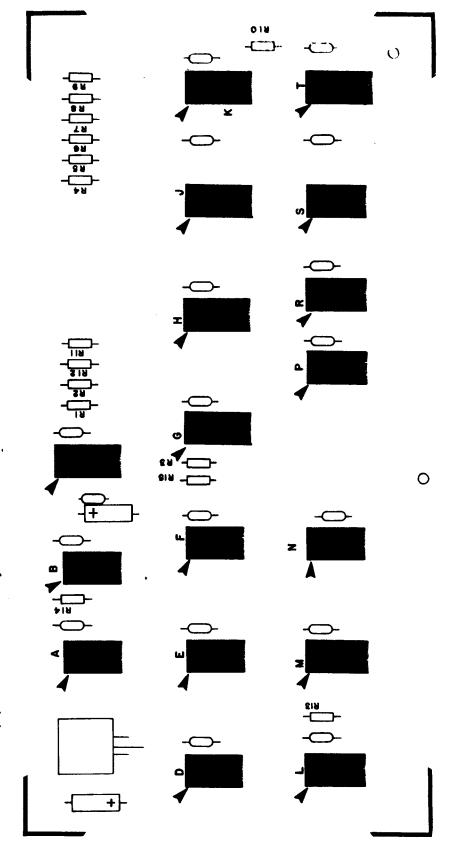

ATTENTION!

SUPPLEMENT to Page 6

- CAPACITOR INSTALLATION -

88-LPC Board Assembly Manual


There is an additional ceramic capacitor to be installed on the 88-LPC board that is not shown on the silk screen. It is .00luF in value and is to be positioned just to the left of IC F.

Insert one of the leads into the hole just opposite pins 2 & 3 of IC F.

(Insert the other lead into the hole in the large pad of the land that goes to pin 8 of IC F.

complete the installation using the procedure on page 6 for ceramic disk capacitor installation.

Take care not to short the leads with any of the lands on the board. Placing masking tape on the board to protect the lands will help prevent this.

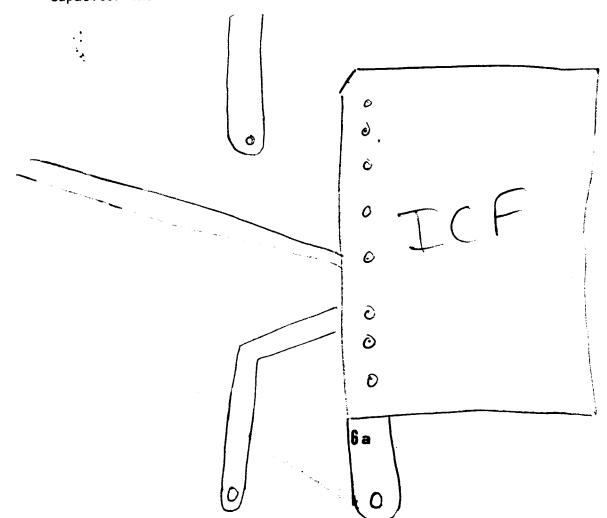

Capacitor Installation


There are 18 ceramic disk and 2 electrolytic capacitors to be installed on the 88-LPC board.

Refer to the component layout and install the ceramic disk capacitors (C3 through C20) according to the following procedure.

- () Beginning with C3 -- a .001µF capacitor -- straighten the two leads and align them as necessary to fit their respective holes on the PC board.
- () Insert the capacitor into the correct holes from the silk-screened side of the board. Push the capacitor down until the ceramic insulation almost touches the foil pattern.
- () Holding the capacitor in place, turn the board over and bend the leads slightly outward.
- () Solder the two leads to the foil pattern on the back side of the board; then clip off any excess lead lengths.

Install the remaining ceramic disk capacitors in this manner. All of them (C4 through C20) will be .luF in value.


The 2 electrolytic capacitors have polarity requirements which must be noted before installation. The capacitors contained in your kit may have one or possibly two of three types of polarity markings. To determine the correct orientation, look for the following (see drawing):

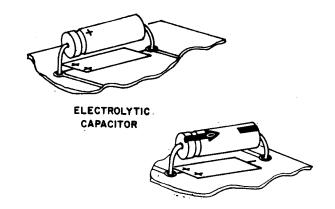

One type will have plus (+) signs on the positive end; another will have a band or a groove around the positive side in addition to the plus signs. The third type will have an arrow on it; in the tip of the arrow there is a negative (-) sign and the capacitor must be oriented so the arrow points to the negative polarity side.

Referring to the component layout, install the electrolytic capacitors. Cl and C2 on the board.

- () Bend the two leads of capacitor C1 (30 F) at right angles to match their respective holes on the board. Insert the capacitor into the holes on the silk-screened side of the board. Be sure to align the positive polarity side with the "+" signs printed on the board.
- () Holding the capacitor in place, turn the board over and bend the two leads slightly outward. Solder the leads to the foil pattern and clip off any excess lead lengths.
- () Install capacitor C2 ($10\mu F$) in the same manner.

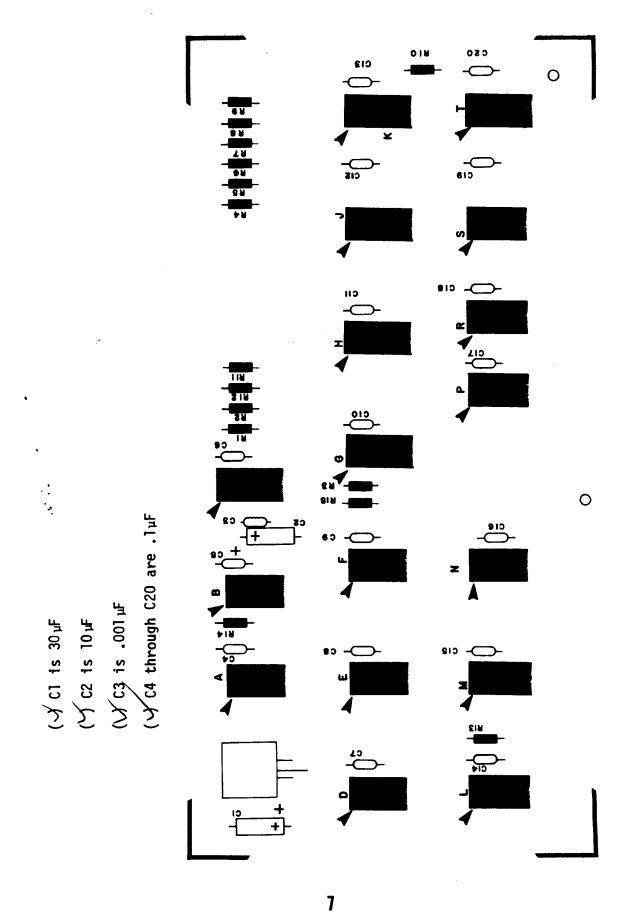


Voltage Regulator Installation


There is one MC7805 5-volt regulator to be installed on the 88-LPC board.

- () Set the MC7805 in place on the board and align the mounting holes. (see drawing, next page)
- () Use a pencil to mark the point on each of the three leads where they line up with their respective holes on the board.
- () Use needle-nose pliers to bend each of the three leads at a right angle on the points where you made the pencil marks.

NOTE: Use heat-sink grease when installing this component. Apply the grease to all surfaces which come in contact with each other.

- regulator and heat sink in place on the silk-screened side of the board. Secure them to the board using a #6-32 x 1/2" screw and #6-32 nut. Hold the regulator in place as you tighten the nut to keep from twisting the leads.
- () Turn the board over and solder the three leads to the foil pattern on the back side of the board. Be sure not to leave any solder bridges.
- () Clip off any excess lead lengths.

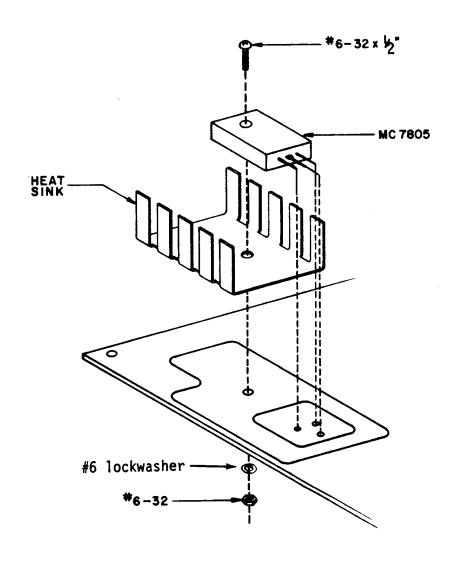

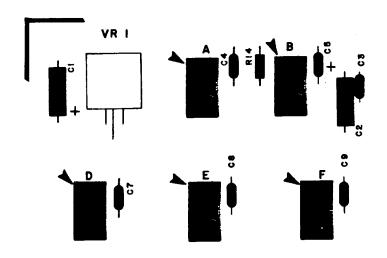

Hardwire Connections

There are seven address selection jumpers and one optional interrupt jumper to be connected on the 88-LPC Board.

- () Prepare seven 1 1/2" wires and one 8" wire by removing 1/8" of insulation from the ends and tinning the exposed portions with a thin coat of solder.

 A7 A6 A5 A4 A3 A2

 Address Selection
- () Connect pads El through E7 to pads Al or AT through A7 or A7 according to the information in the I/O Address Selection Chart to obtain the octal address listed in the left column.

NOTE: The connections labeled Il through I7 on the chart correspond to the pads labeled El through E7 on the 88-LPC board.

- () Insert the wires into the correct holes from the silk screened side of the board. Be sure not to insert any of the insulated portion into the hole.
- () Turn the board over and solder the wires to the foil pattern on the back side of the board.

Refer to the Theory of Operation section for further explanation of this function.

Vectored Interrupt

This is an optional function on the 8800 system, and need not be used at all. If it is to be used, it must be used in conjunction with the 88-VI vectored interrupt card. There is one exception to this which will be explained towards the end of this section.

The 88-LPC Board has provisions for vectored interrupt hardwire connections. This provides the user with the option of selecting a priority level for the line printer.

The vectored interrupt offers 8 levels of priority, 0 through 7, with 7 being the highest priority level.

There is a pad below IC T labeled E8 and there are eight pads at the bottom of the board labeled "VI" and numbered "O" through "7." The eight numbered pads correspond to the eight priority levels respectively.


- () Connect pad E8 to the desired vectored interrupt priority by inserting the ends of the 8" wire into the proper holes from the silk screened side of the board. Be careful not to insert any of the insulated portion of the wire.
- () Turn the board over and solder the wire leads to the foil pattern:

It is possible to obtain a <u>single</u> level of interrupt priority on this board without the necessity of the 88-VI Vectored Interrupt card.

This may be used only on one of the I/O cards in your system.


() To obtain a single level of interrupt priority, use the 8" wire to connect pad E8 to pad PINT, employing the above procedure.

Remember, only one I/O board in your system may be connected in this manner.

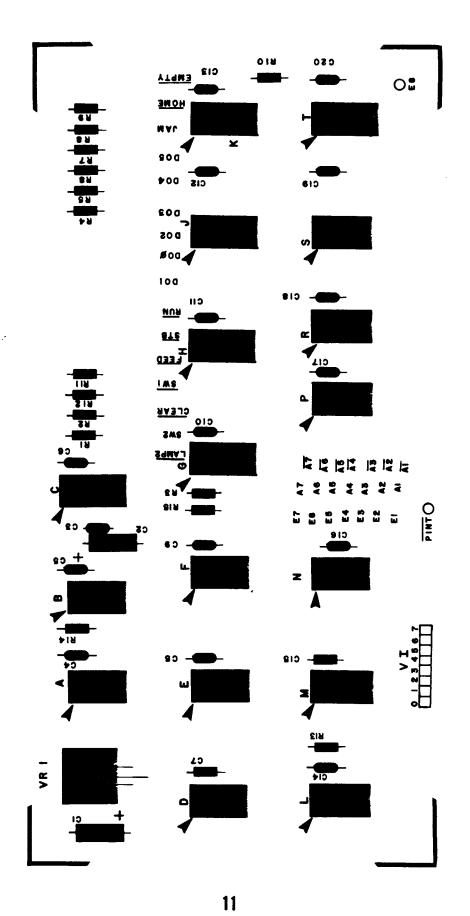

Male Connector Installation

There are three 10-pin male connectors to be installed on the 88-LPC board. The connectors will be installed in the 30 holes on the board labeled LAMP through EMPTY.

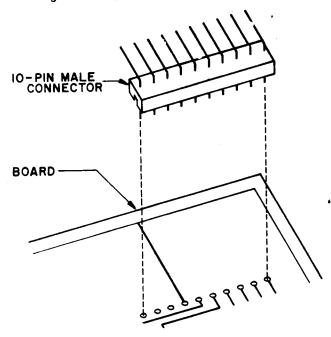

- () Referring to the above drawing for proper orientation, install the three 10-pin connectors into the holes from the silk-screened side of the board. Be sure to insert the side with the shorter, straight pins.
- () Holding the connectors in place, turn the board over and solder all 30 pins to the foil pattern on the back side of the board.


Cable Preparation

- () Cut a 2-foot length of twisted pair cable from the 8-foot length supplied with your kit. Set the 6-foot piece aside for later use.
- () Take the 2-foot length of cable and place a piece of masking tape aroung one end, l" from the end. Put another piece of tape around the sheath, 4" from the other end. Peel the cable sheath back as far as the tape from both ends so that the 18 twisted pairs of wires are exposed.

() Strip 1/8 inch of insulation from each wire at both ends. Tin all the wires by applying a thin coat of solder at both ends.

37-Pin Connector Installation

Select one of the 37-pin female connectors from your kit. This connector is to be wired to the end of the cable that has 1 inch of wire exposed. As you solder each wire to the connector, attach a connector pin (see drawing) to the other end of that wire.



Starting with the twisted pair at one edge of the cable, attach the wires in order, working toward the other edge. The columns on the next page labeled "Colored Wire" and "Black Wire" refer to the two wires that make up each twisted pair. Use the following procedure to solder each wire to its proper pin on the connector. (Seven pins will not be used.)

NOTE: These procedures must be done carefully with close attention to detail. You may wish to prop the connector between blocks of wood (or in a vice) so that you will have both hands free while working with the connector.

- () Prepare the connector by heating each pin with your soldering iron and filling the hollow space with solder.
- () Connect the wires to the pins in the order given on the next page. Make each connection by re-melting the solder in the pin, inserting the wire up to the insulation, and removing the heat from the pin while

holding the wire in place until the solder cools. Do not melt any of the insulation.

() Attach a connector pin to the other end of each wire after it is soldered to the connector. Some of the wires are not used and are to be clipped off at the cable sheath. In these cases, clip off both ends of the wire at the sheath.


	COLORED WIRE	BLACK WIRE
() First twisted pair	pin 1	pin 20
() Second twisted pair	pin 2	pin 21
() Third twisted pair	pin 3	pin 22
() Fourth twisted pair	clip off	clip off
() Fifth twisted pair	pin 5	pin 24
() Sixth twisted pair	pin 6	clip off
() Seventh twisted pair	pin 7	pin 26
() Eighth twisted pair	pin 8	pin 27
() Ninth twisted pair	pin 9	pin 28
() Tenth twisted pair	pin 10	pin 29
() Eleventh twisted pair	pin 11	pin 30
() Twelfth twisted pair	clip off	clip off
() Thirteenth twisted pair	pin 13	clip off
() Fourteenth twisted pair	pin 14	pin 33
() Fifteenth twisted pair	pin 15	pin 34
() Sixteenth twisted pair	pin 16	pin 35
() Seventeenth twisted pair	pin 19	pin 36
() Eighteenth twisted pair	pin 18	pin 37


Wire 10-Pin Female Connectors

The connector pins you have attached to the 4-inch exposed wires will be inserted into the three 10-pin female connectors, as shown in the drawing, right.

Each of the holes on the female connectors will correspond to a labeled connection on the board or to a ground connection. The identification of each hole is indicated with an arrow in the diagram below. The identification of the correct wire for each hole is indicated on the chart on the next page.

- () Use masking tape to label the three 10-pin female connectors "1", "2" and "3". Orient the connectors as shown in the diagram.
- () Begin at the same side of the cable as before and insert the wires in the same order, beginning with the first twisted pair. As you insert each wire, refer to the diagram and to the chart to make sure you are inserting the wire into the correct hole.

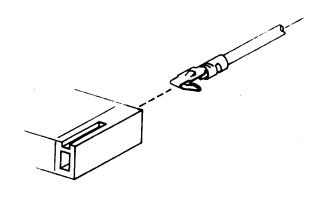

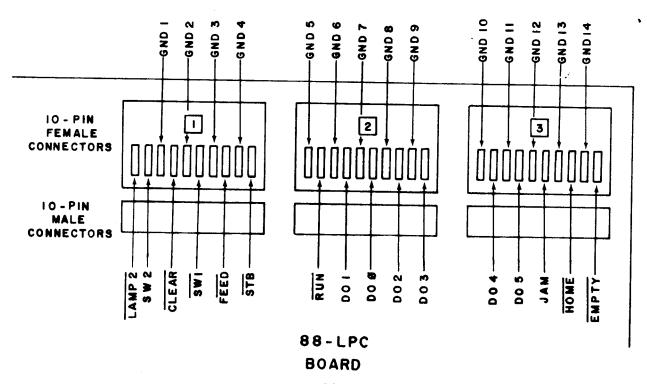


	CONNECTOR #	COLORED WIRE	BLACK WIRE
() First twisted pair	1	SWT	GND 2
() Second twisted pair	3	HOME	GND 13
() Third twisted pair	3	EMPTY	GND 14
() Fourth twisted pair	-	clipped off	clipped off
() Fifth twisted pair	1	CLEAR	GND 1
() Sixth twisted pair	1	SW2	clipped off
() Seventh twisted pair	3	JAM	GND 12
() Eighth twisted pair	1	STB	GND 4
() Ninth twisted pair	2	D01	GND 6
() Tenth twisted pair	2	D03	GND 9
() Eleventh twisted pair	3	D04	GND 10
(.) Twelfth twisted pair	-	clipped off	clipped off
().Thirteenth twisted pair	1	·LAMP 2	clipped off
() Fourteenth twisted pair	2	DOØ	GND 7
() Fifteenth twisted pair	2	RUN	GND 5
() Sixteenth twisted pair	1	FEED	GND 3
() Seventeenth twisted pair	2	D02	GND 8
() Eighteenth twisted pair	3	D05	GND 11

Mount 37-Pin Connector

When all of the wires have been connected, the 37-pin female connector will be mounted to the back panel of the Altair with a connector bracket. There are spaces provided on the back panel for mounting 25-pin connectors. The 37-pin connector bracket will mount over two of these spaces on the outside of the back panel.


() Before mounting the 37-pin connector, first put the cable and the 10-pin female connectors inside the 8800 case by passing them through one of the spaces in the back panel. (Since the bracket covers up two spaces, you will want to choose a space that doesn't have another connector mounted next to it.)

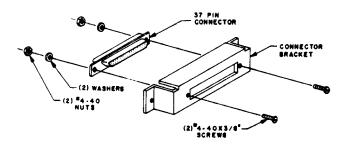

- () Referring to the drawing above, insert the connector into the back of the bracket. Fasten it to the bracket with two #4-40 x 3/8 inch screws, two washers and two #4-40 nuts.
- () Mount the bracket to the back panel using two #4-40 x 5/8 inch screws, two #4-40 nuts and two #4 lock-washers.

Female Connector Installation

The three 10-pin female connectors must be installed onto the three male connectors on the PC board. Refer to the two diagrams below for proper orientation and correct placement of the connectors.

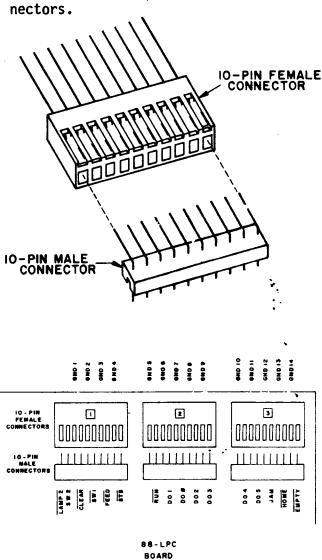

() Install the three female connectors onto the male connectors on the board.

Leave the labels on the connectors for future reference, in case the board has to be removed.

Connector Cable

Remove the remaining 6-foot length of twisted-pair cable from your kit. This cable, wired to the two remaining 37-pin connectors, will connect the line printer to the Altair.

- () Place a piece of masking tape around one end of the cable sheath, I inch from the end. Peel the cable sheath back as far as the tape so that I inch of wires is exposed at the end.
- () Prepare these wires by removing 1/8 inch of insulation from the ends and tinning the ends with a thin coat of solder.
- () Prepare the male 37-pin connector by heating each pin with a soldering iron and filling the hollow space in the pin with solder.
- () Beginning with the first twisted pair at one edge of the cable, connect the wires to the male connector pins in the order given on the next page. (As in the previous procedure, 7 of the pins will not be used and 6 of the wires will be clipped off.) Make each connection by remelting the solder in the pin, inserting the wire up to the insulation, and removing the heat from the pin while holding the wire in place until the solder cools. Do not melt any of the insulation.

Before installing the female connector at the other end of the cable, a connector cover must be installed onto the male connector.

- () Slide the connector cover onto the cable by gathering up the free end of the cable, inserting it into the wide opening on the cover and pulling it out through the narrow opening. Now push the cover up the full length of the cable and install it on the male connector with the two screws provided.
- () Wire the female connector to the other end of the cable by repeating the first four steps above. (The female connector will not have a connector cover.)

NOTE: As you wire the female connector, always be sure you have connected the same pin numbers with the same wire. (pin 1 to pin 1, pin 20 to pin 20, etc.)

			COLORED WIRE	BLACK WIRE
()	First twisted pair	pin 1	pin 20
()	Second twisted pair	pin 2	pin 21
()	Third twisted pair	pin 3	p in 22
()	Fourth twisted pair	clip off	clip off
()	Fifth twisted pair	pin 5	pin 24
()	Sixth twisted pair	pin 6	clip off
()	Seventh twisted pair	pin 7	pin 26
()	Eighth twisted pair	pin 8	pin 27
()	Ninth twisted pair	pin 9	pin 28
()	Tenth twisted pair	pin 10	pin 29
()	Eleventh twisted pair	pin 11	pin 30
()	Twelfth twisted pair	clip off	clip off
()	Thirteenth twisted pair	pin 13	clip off
()	Fourteenth twisted pair	pin 14	. pin 33
()	Fifteenth twisted pair	pin 15	pin 34
()	Sixteenth twisted pair	pin 16	pin 35
()	Seventeenth twisted pair	pin 19	pin 36
()	Eighteenth twisted pair	pin 18	pin 37

Line Printer Interconnect

- () To connect the line printer to the Altair, attach the male connector on the 6-foot cable to the female connector mounted on the back panel of the Altair.
- () Connect the female connector on the 6-foot cable to the male connector on the line printer. To do this, raise the cover on the line printer case top and remove the platten and pin feed apparatus. Then remove the entire case top by taking out the four screws that hold it in place. The 37-pin male connector is at the front, left-hand side of the line printer. Bring the female connector through the opening in the left side of the case and connect it to the male connector.

NOTE: As you reassemble the case top, make sure you insert the placement pins on the platten into their slots on either side of the line printer. If the platten isn't placed properly, the cover won't close.

Altair 88-LPC Board

88-LPC Board Assembly Manual

Erratum, Cable Preparation and Assembly Instructions

Please ignore the cable assembly instructions. The cables have been factory assembled.

88-80LP (Line Printer& Controller) Parts List Sept. 1975

BAG	<u>1</u>		BAG	<u>5</u> .	
1 2 4 1 1 1 1 3 2	74L00 74L02 74L04 74L10 74L30 7472 74Ls74 74L123 8T97 8T98	101080 101072 101073 101081 101082 101026 101088 101078 101040 101045	8 5 1 1 1 4 4 4 1	1½" Wire #6-32x½" Screw #6-32 Nut #6-32 LockWasher Twisted 18 Pr Cable 8 ft 4-40x5/8 Screw 4-40 Hexnut #4 Lockwasher 8" Wire	103002 100918 100933 100942 103066 100904 100932 100941 103041
D 4 C	0			CELLANEOUS	
BAG	`	404005	1	PC Board LP Manual	100179 101518
4 1 4 1 1	220 ohm \$\frac{1}{2} \widety 5\times 5	101925 101926 101944 101392 102089 101945	1	Okadata Printer with Controller	101781
BAG	3				
2 17 1	.001 uf 10v .1uf 10v 10uf 20v 30uf 10v	100328 100348 100352 100369			
BAG	4				
1	Heatsink (Large) Molex Connectors:	101870			
3 30 2 1 1 1 1	Right Angle 10-pin Plug Terminals 37-pin Conn (Female) 37-pin Conn (Male) 37-pin Bracket 37-pin Cover (Plastic) Edge Connector Card Guides	101812 101768 101769 102114 102115 101795 101799 101864 101714			

Chip	Function	National Semiconductor 1976 TTL Databook page
74L00	Quad 2 Input NAND Gates	1-1
74L02	Quad 2 Input NOR Gates	1-2
74L04	Hex Inverters	1-4
74L10	Triple 3 Input NAND Gates	1-5
74L30	8 Input NAND Gate	1-9
7472	AND-Gated J-K Master-Slave Flip-Flop with Preset and Clear	1-19
74L74	Dual D Positive Edge Triggered Flip-Flops with Preset and Clear	1-20
74L123	Dual Retriggerable One Shots with Clear	1-26
	Tristate Hex Buffers (with different truth (also known as 8T97 and 8T98)	tables)1-32,33