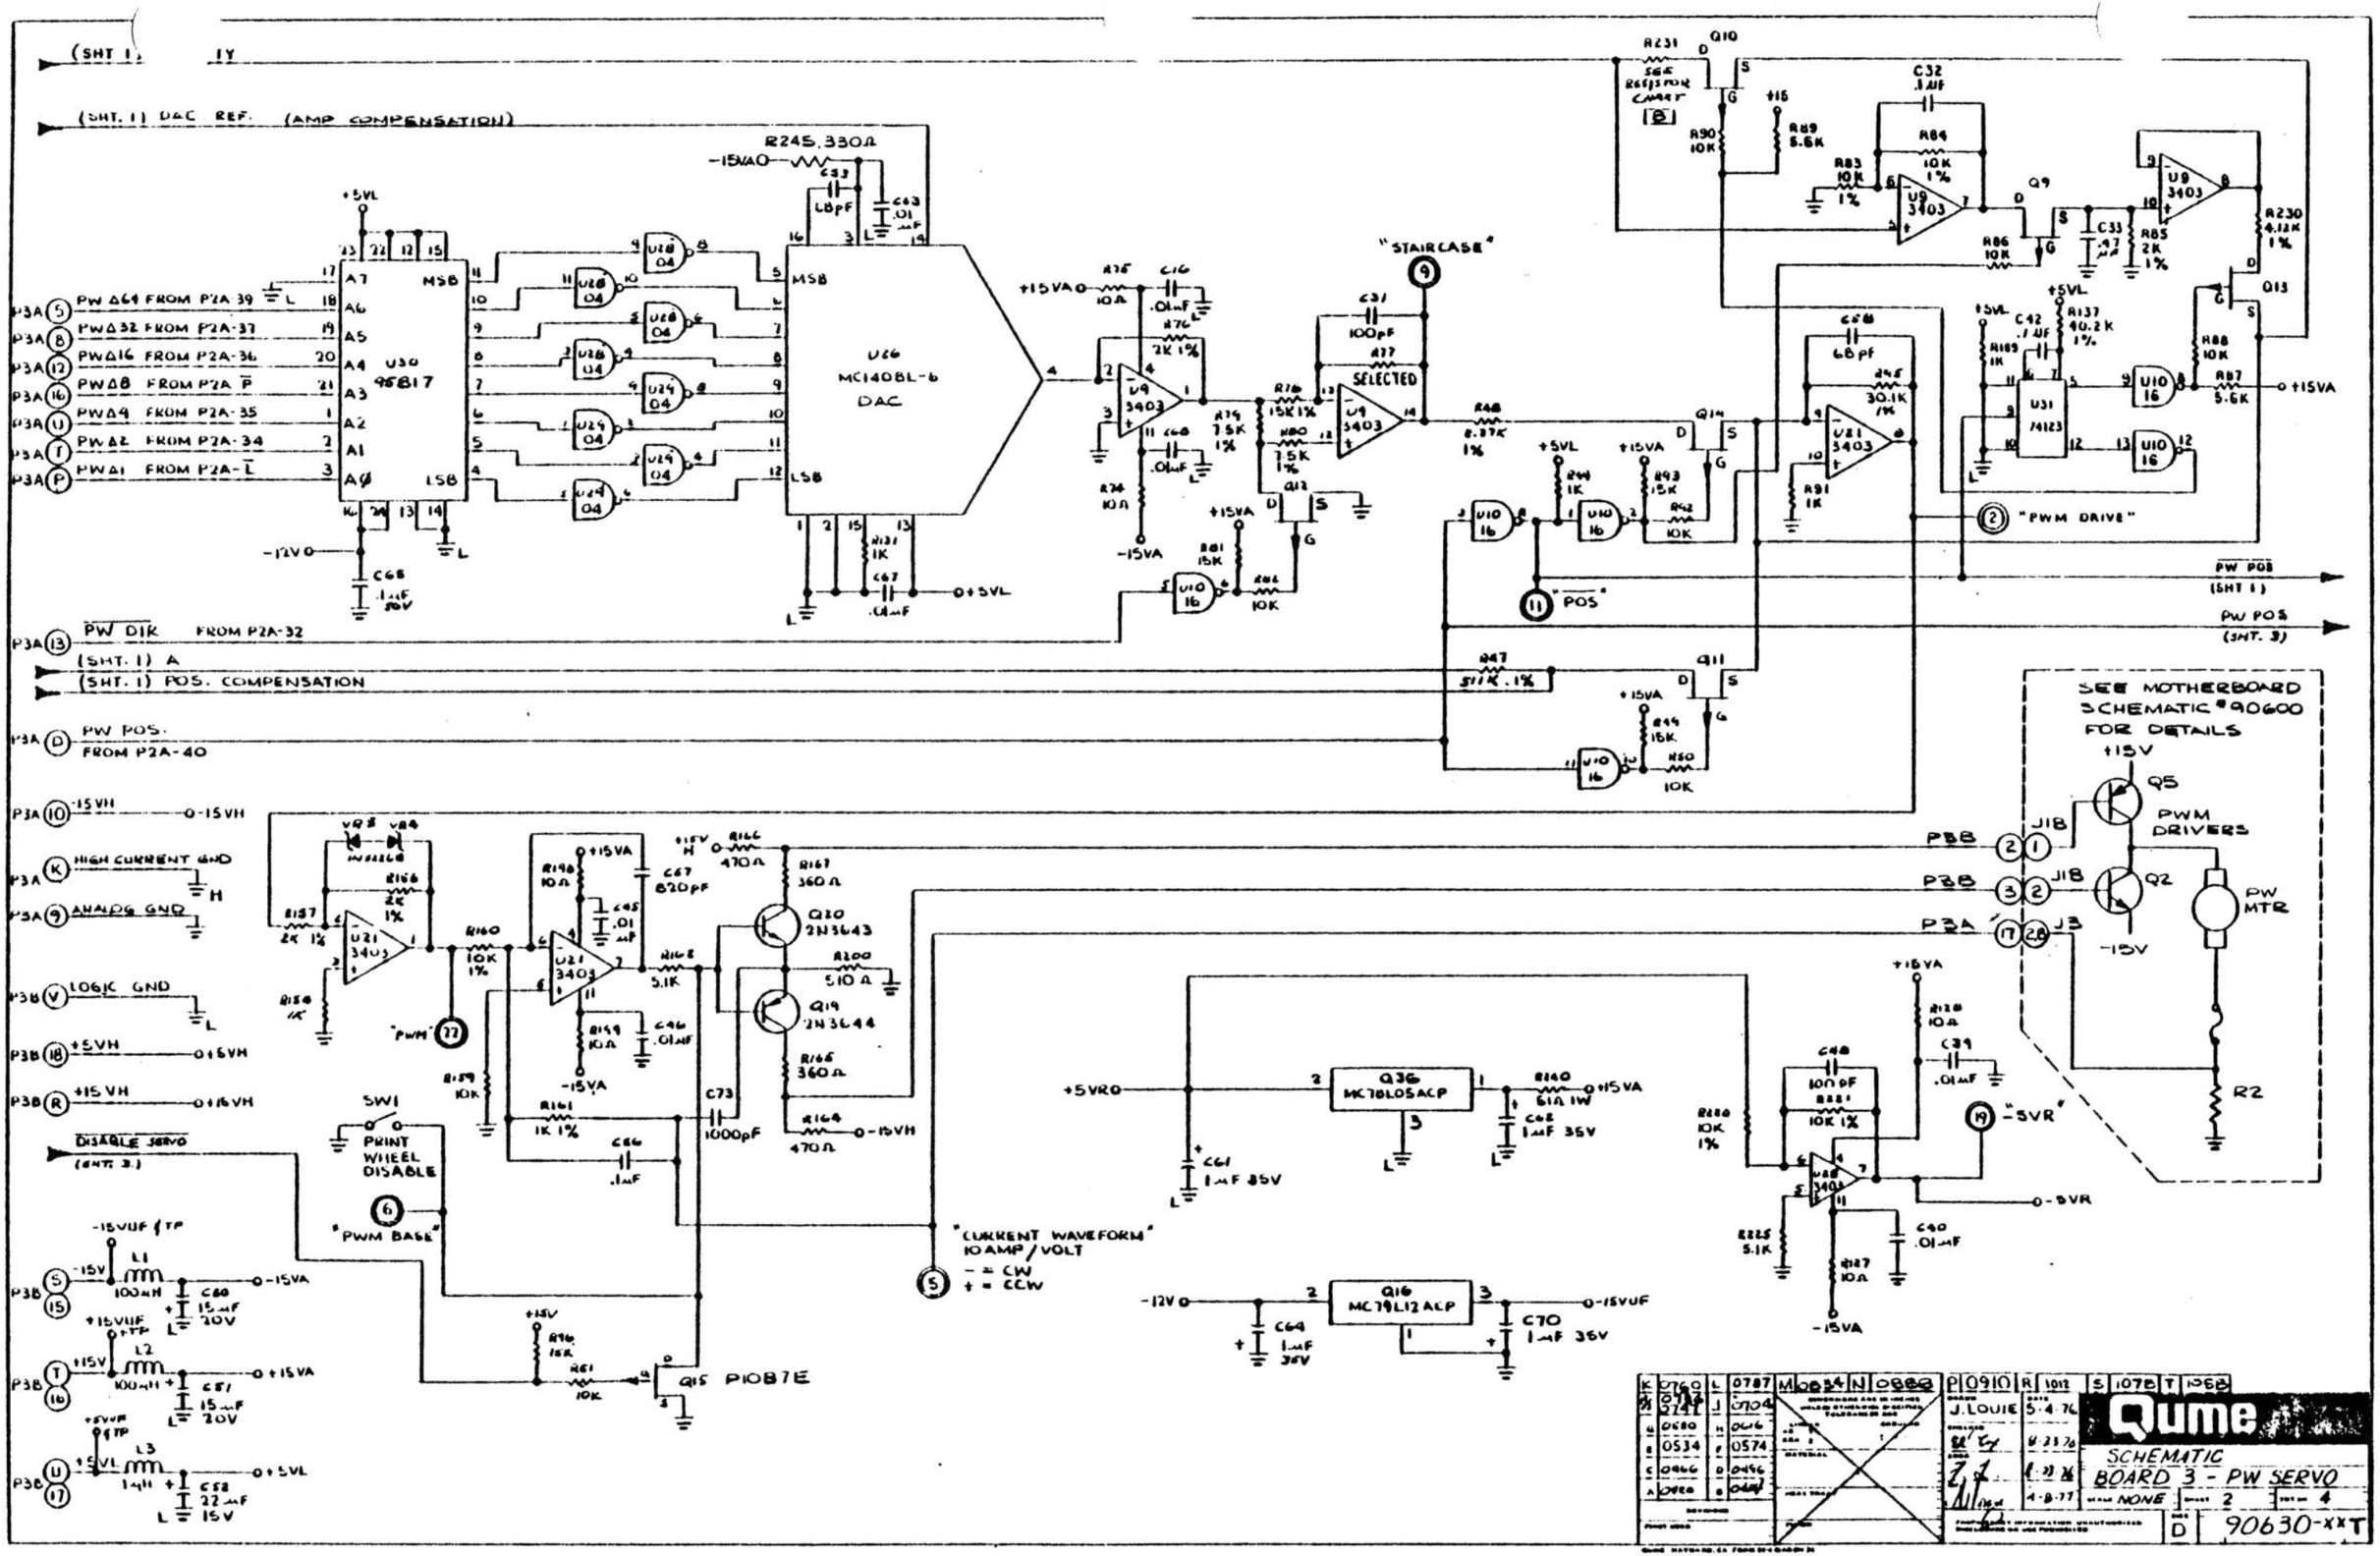
(SHT 1) IY
(SHT. 1) DAC REF. (AMP COMPENSATION)
R245, 330Ω
U30 95B17
U26 MC1408L-6 DAC
"STAIRCASE"
SELECTED
"PWM DRIVE"
"POS"
PW POS (SHT 1)
PW POS (SHT. 3)
PW DIR FROM P2A-32
(SHT. 1) A
(SHT. 1) POS. COMPENSATION
PW POS. FROM P2A-40
HIGH CURRENT GND
ANALOG GND
LOGIC GND
DISABLE SERVO (SHT. 3)
PRINT WHEEL DISABLE
"PWM BASE"
"PWM"
"CURRENT WAVEFORM" 10 AMP/VOLT
- = CW
+ = CCW
Q15 P10B7E
Q36 MC78L05ACP
Q16 MC79L12ACP
"-SVR"
SEE MOTHERBOARD SCHEMATIC #90600 FOR DETAILS
PWM DRIVERS
PW MTR
R2
Qume
SCHEMATIC
BOARD 3 - PW SERVO
90630-XXT